


100-16457 18 NOV 63

TOP SECRET

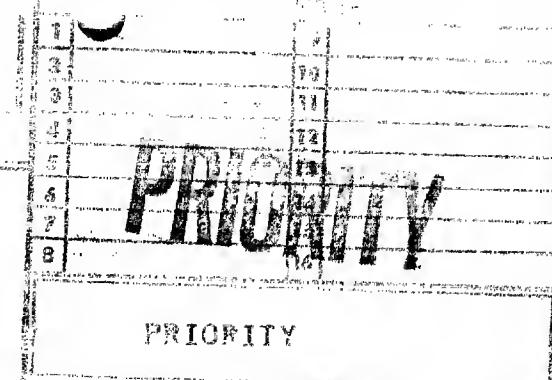

PRIORITY

TO: DIRECTOR

FROM: [REDACTED] 25X1

REASON: OPS 1-8

INFO:

TO: 1151Z 18 NOV 63

25X1

IN 50921

25X1

PRIORITY [REDACTED]

INFO PRIORITY [REDACTED]

25X1

7551

25X1

A. G 3241 25X1

B. B CAMERA/6,719/ [REDACTED]

C. 9L TRENTON, NBR 2/FULL HEAD TO TAIL/PRI 70 DEGREES SEC 80 DEGREES
9R TRENTON, NBR 1/FULL HEAD TO TAIL/PRI 70 DEGREES SEC 80 DEGREES

D. HEAD 9L 2.50 TAIL 2.52

HEAD 9R 2.40 TAIL 2.49

E. 9L/3402/234-21-6-3

9R/3402/219-20-4-6-3

F. 1. GOOD

2. GOOD

3. GOOD

4. GOOD

25 YEAR RE-REVIEW

5. GOOD

6. GOOD

7. CLEAR

G. PRESSURE ROLLER STATIC (CHATTER) IS NOTED ON THE INBOARD
EDGE OF THE 9L FILM FOR APPROXIMATELY THE FIRST THIRD OF THE

TOP SECRET

GROUP 1
Excluded from automatic
downgrading and
declassification

[REDACTED] 7551 (IN 50921)

TOP SECRET

PAGE TWO

MISSION/A MINUS DENSITY STREAK OCCURS 0.7 INCHES FROM AND ROUGHLY PARALLEL TO THE INBOARD EDGE OF THE 9R FILM FOR THE FIRST 1144 FRAMES/A FINE SCRATCH IS NOTED BETWEEN FRAMES 296 AND 1114 ON THE 9R SIDE. THIS SCRATCH IS CAUSED BY A EMULSION LIFTED ON FRAME 296 AND IT IS CLEARED THROUGH THE CAMERA BY THE MANUFACTURES' S SPLICE ON FRAME 1114/TOTAL TITLED FRAMES ON EACH SIDE 2030 CLOUD COVER APPROXIMATELY 25 PERCENT.

No. HELD AT

[REDACTED] FOR REPRODUCTION.

25X1

END OF MESSAGE

TOP SECRET